

CUSTOMER #:

240378



INVOICE

JAGUAR LAND ROVER
EDMONTON
 DUPLICATE 2 17007 111th Ave. NW, Edmonton, AB T5S 0J6
 PAGE 1 Tel: 780-484-1818 Fax: 780-733-7942
 www.jlredmonton.com

BUS:		CELL:		SERVICE ADVISOR: 115397 KATE LAPINA			
COLOUR	YEAR	MAKE/MODEL	VIN	LICENSE	ODOMETER IN/OUT	TAG	
SILVER	18	LAND ROVER RANGE ROV	SALYM2RV9JA725974		98120/100739	T4138	
DEL DATE	PROD. DATE	WARR. EXP.	PROMISED	PO NO.	RATE	PAYMENT	INV. DATE
01JAN18 IS			17:00 11JUN25		238.00	CASH	24JUN25
01JAN18 DE							
R.O. OPENED		READY		OPTIONS: SOLD-STK:PC864 DLR:502 ENG:3.0 Liter			
08:35 10FEB25		11:07 24JUN25		TRN:8_Speed Automatic			

LINE	OPCODE	TECH	TYPE	HOURS	LIST	NET	TOTAL
------	--------	------	------	-------	------	-----	-------

A CUSTOMER REPORTS WHILE DRIVING VEHICLE STARTED OVERHEATING, CEL CAME ON, STARTED SMOKING FROM UNDER THE HOOD. ** CUSTOMER MENTIONS "PRIOR "COOLANT LOW" WARNING " WAS ON, TOPPED UP COOLEANT. CHECK AND ADVISE.

L00 General Diagnostics
116666 IIVU 1.00

PARTS: 0.00 LABOR: 0.00 OTHER: 0.00 TOTAL LINE A: (N/C) 0.00

INSPECT FOR ENGINE OVERHEATING, CONFIRM COOLANT LEVEL LOW, VEHICLE EXHIBITING SIGNS OF OVERHEATING, WHITE SMOKE FROM EXHAUST SYSTEM, EXCESSIVE PRESSURE IN COOLING SYSTEM. PERFORM NETWORK INTEGRITY TEST WITH TOPIX CLOUD, FOUND P0480-71 FAN 1 CONTROL CIRCUIT-ACTUATOR STUCK DTC LOGGED IN PCM. INSPECT COOLING FAN OPERATION, TURN COOLING FAN BY HAND AND NOTED DIFFICULT TO TURN, START ENGINE AND TURN ON MAX AC, NOTED COOLING FAN NOT TURNING. CHECK POWER AND GROUND TO COOLING FAN, POWER AND GROUND OK, CHECK PWM SIGNAL TO COOLING FAN, PWM SIGNAL FROM PCM PRESENT. ELECTRIC COOLING FAN FAILURE PRESENT, ENGINE OVERHEATED WITH NO COOLING FAN OPERATION. RECOMMEND REPLACE ELECTRIC COOLING FAN. QUOTED FOR HEADGASKET REPLACEMENT AND ENGINE LONG BLOCK ASSEMBLY REPLACEMENT.

B DURING CHECK IN " BATTERY LOW" WARNING MESSAGE IS ON

L00 General Diagnostics
116666 IIVU 1.00

PARTS: 0.00 LABOR: 0.00 OTHER: 0.00 TOTAL LINE B: (N/C) 0.00

INSPECT FOR LOW BATTERY WARNING PRESENT, CONFIRM CONCERN LOW BATTERY PLEASE START ENGINE MESSAGE DISPLAYED. PERFORM DIAGNOSTIC CHARGE WITH GRX-3080. DIAGNOSTIC CHARGE FAILS, REPLACE BATTERY RECOMMENDED.

C DURING CHECK IN FRONT DRIVER DOOR HANDLE DOESN'T POP OUT.

L00 General Diagnostics
116666 IIVU 1.00

PARTS: 0.00 LABOR: 0.00 OTHER: 0.00 TOTAL LINE C: (N/C) 0.00

INSPECT FOR DRIVERS DOOR HANDLE NOT DEPLOYING, CONFIRM CONCERN

ON BEHALF OF SERVICING DEALER, I HEREBY CERTIFY THAT THE INFORMATION CONTAINED HEREON IS ACCURATE UNLESS OTHERWISE SHOWN. SERVICES DESCRIBED WERE PERFORMED AT NO CHARGE TO OWNER. THERE WAS NO INDICATION FROM THE APPEARANCE OF THE VEHICLE OR OTHERWISE, THAT ANY PART REPAIRED OR REPLACED UNDER THIS CLAIM HAD BEEN CONNECTED IN ANY WAY WITH ANY ACCIDENT, NEGLIGENCE OR MISUSE. RECORDS SUPPORTING THIS CLAIM ARE AVAILABLE FOR (1) YEAR FROM THE DATE OF PAYMENT NOTIFICATION AT THE SERVICING DEALER FOR INSPECTION BY MANUFACTURER'S REPRESENTATIVE.

STATEMENT OF DISCLAIMER
The factory warranty constitutes all of the warranties with respect to the sale of this item/items. The Seller hereby expressly disclaims all warranties, either express or implied, including any implied warranty of merchantability or fitness for a particular purpose. Seller neither assumes nor authorizes any other person to assume for it any liability in connection with the sale of this item/items.

DESCRIPTION	TOTALS
LABOUR AMOUNT	
PARTS AMOUNT	
DISCOUNTS	
SUBLET AMOUNT	
MISC. CHARGES	
TOTAL CHARGES	
LESS INSURANCE	
G.S.T./P.S.T.	
PLEASE PAY THIS AMOUNT	

(SIGNED) DEALER, GENERAL MANAGER OR AUTHORIZED PERSON (DATE)

CUSTOMER SIGNATURE

GST#864946462 RT 0001

CUSTOMER COPY

CUSTOMER #: 123290

240378



INVOICE

JAGUAR LAND ROVER

EDMONTON

DUPLICATE 2

PAGE 2

17007 111th Ave. NW, Edmonton, AB T5S 0J5

Tel: 780-484-1818 Fax: 780-733-7942

www.jlredmonton.com

BUS:

CELL:

SERVICE ADVISOR: 115397 KATE LAPINA

SERVICE ADVISOR: 115397 KATE LAPINA									
COLOUR	YEAR	MAKE/MODEL		VIN		LICENSE	ODOMETER IN/OUT		TAG
SILVER	18	LAND ROVER RANGE ROV		SALYM2RV9JA725974			98120/100739		T4138
DEL DATE	PROD. DATE	WARR. EXP.	PROMISED		PO NO.	RATE	PAYMENT	INV. DATE	
01JAN18 IS									
01JAN18 DE			17:00 11JUN25			238.00	CASH	24JUN25	
R.O. OPENED		READY		OPTIONS: SOLD-STK:PC864 DLR:502 ENG:3.0_Liter					
08:35 10FEB25		11:07 24JUN25		TRN:8_Speed_Automatic					

LINE OPCODE TECH TYPE HOURS

LIST NET TOTAL

HANDLE IS NOT DEPLOYING WITH VEHICLE UNLOCK REQUEST. PERFORM NETWORK INTEGRITY TEST WITH TOPIX CLOUD, FOUND DRIVERS DOOR MODULE LOGGING B1DD7-15 DEPLOYABLE DOOR HAND RETRACT SWITCH-CIRCUIT SHORT TO BATTERY OR OPEN. PERFORM ELECTRICAL TESTING AS PER DTC HELPTXT, REMOVE DRIVERS DOOR PANEL TO GAIN ACCESS TO DOOR MODULE, DISCONNECT BATTERY NEGATIVE TERMINAL AND CHECK CONTINUITY BETWEEN C5PW02AD-18 AND C5PW02AD-24, 0.2 OHMS PRESENT, CONTINUITY PRESENT. AS PER DTC HELPTXT, CLEAR DTC AND RETEST, DEPLOYABLE DOOR HANDLE OPERATING AS DESIGNED, RECOMMEND MONITOR.

D** CUSTOMER REPORTS PLUGS IN THE VEHICLE FOR OVERNIGHT BUT STILL HAS TROUBLE TO START IN THE MORNING. AS PER CUSTOMER TAKES 4-20 TIMES TO TRY, TO START THE VEHICLE.

L00 General Diagnostics

116666 ISAL 0.00

(N/C)

PARTS: 0.00 LABOR: 0.00 OTHER: 0.00 TOTAL LINE D: 0.00

ENGINE REPLACEMENT PERFORMED ON LINE F, SUMMER WEATHER PRESENT. RECOMMEND MONITOR ENGINE STARTING PERFORMANCE AFTER ENGINE REPLACEMENT. VERIFIED ENGINE BLOCK HEATER CORD INSTALLED DURING ENGINE REPLACEMENT.

E** REPLACE START UP BATTERY-DIAGNOSTIC CHARGE FAILED.

L00 REPLACE START UP BATTERY-DIAGNOSTIC CHARGE

FAILED.

116666 IIVU 1.00

(N/C)

1 LR104511 BATTERY

(N/C)

PARTS: 0.00 LABOR: 0.00 OTHER: 0.00 TOTAL LINE E: 0.00

REPLACE START UP BATTERY, PERFORM GATEWAY MODULE BATTERY MONITOR RESET.

F** REPLACE ENGINE ASSEMBLY FOR OVERHEATING

L00 ENGINE ASSEMBLY REPLACED

116666 CEXT 28.00

4080.70 4080.70

1 LR116110 GASKET - EXHAUST

112.20 68.00 68.00

1 LR011068 BOLT

8.16 3.89 3.89

ON BEHALF OF SERVICING DEALER, I HEREBY CERTIFY THAT THE INFORMATION CONTAINED HEREON IS ACCURATE UNLESS OTHERWISE SHOWN. SERVICES DESCRIBED WERE PERFORMED AT NO CHARGE TO OWNER. THERE WAS NO INDICATION FROM THE APPEARANCE OF THE VEHICLE OR OTHERWISE, THAT ANY PART REPAIRED OR REPLACED UNDER THIS CLAIM HAD BEEN CONNECTED IN ANY WAY WITH ANY ACCIDENT, NEGLIGENCE OR MISUSE. RECORDS SUPPORTING THIS CLAIM ARE AVAILABLE FOR (1) YEAR FROM THE DATE OF PAYMENT NOTIFICATION AT THE SERVICING DEALER FOR INSPECTION BY MANUFACTURER'S REPRESENTATIVE.

STATEMENT OF DISCLAIMER
The factory warranty constitutes all of the warranties with respect to the sale of this item/items. The Seller hereby expressly disclaims all warranties, either express or implied, including any implied warranty of merchantability or fitness for a particular purpose. Seller neither assumes nor authorizes any other person to assume for it any liability in connection with the sale of this item/items.

DESCRIPTION	TOTALS
LABOUR AMOUNT	
PARTS AMOUNT	
DISCOUNTS	
SUBLET AMOUNT	
MISC. CHARGES	
TOTAL CHARGES	
LESS INSURANCE	
G.S.T./P.S.T.	

(SIGNED) DEALER, GENERAL MANAGER OR AUTHORIZED PERSON (DATE)

CUSTOMER SIGNATURE

PLEASE PAY THIS AMOUNT

GST#864946462 RT 0001

CUSTOMER #: 123290

240378



INVOICE

JAGUAR LAND ROVER

EDMONTON

 DUPLICATE 2 17007 111th Ave. NW, Edmonton, AB T5S 0J5
 PAGE 3 Tel: 780-484-1818 Fax: 780-733-7942

www.jredmonton.com

BUS:		CELL:		SERVICE ADVISOR: 115397 KATE LAPINA			
COLOUR	YEAR	MAKE/MODEL	VIN		LICENSE	ODOMETER IN/ OUT	TAG
SILVER	18	LAND ROVER RANGE ROV	SALYM2RV9JA725974			98120/100739	T4138
DEL DATE	PROD. DATE	WARR. EXP.	PROMISED	PO NO.	RATE	PAYMENT	INV. DATE
01JAN18 IS							
01JAN18 DL			17:00 11JUN25		238.00	CASH	24JUN25
R.O. OPENED		READY		OPTIONS: SOLD-STK:PC864 DLR:502 ENG:3.0 Liter			
08:35 10FEB25		11:07 24JUN25		TRN:8_Speed_Automatic			

LINE	OPCODE	TECH	TYPE	HOURS	LIST	NET	TOTAL
3	LR034008	BOLT			10.17	4.85	14.55
1	LR116111	GASKET - EXHAUST			112.20	68.00	68.00
1	LR123709	PLUG - OIL DRAIN			16.09	9.53	9.53
2	LR093715	CIRCLIP - INNER			13.41	6.39	12.78
1	LR096012	PLUG - OIL			12.35	7.32	7.32
2	LR024151	NUT AND WASHER -			22.95	14.90	29.80
1	LR012685	SEAL - VACUUM PU			39.27	29.75	29.75
2	LR090520	BOLT			8.49	4.05	8.10
1	LR165688	KIT - "O" RING			30.12	16.87	16.87
1	LR010793	GASKET - WATER M			22.59	13.70	13.70
4	LR092703	BOLT			4.92	2.34	9.36
2	LR010861	O-RING			26.40	17.15	34.30
1	LR010770	GASKET - OIL COO			27.41	16.61	16.61
4	LR038661	SCREW			2.61	1.24	4.96
1	LRN2279	FLUID - COOLING			44.56	40.51	40.51
1	EHC50	Environmental Handling Charge			0.50	0.50	0.50
2	FY110056	NUT			13.05	6.22	12.44
2	FY110056	NUT			13.05	6.22	12.44
1	LR028136	TUBE - OIL COOLE			66.48	40.29	40.29
7	0208900	CASTROL EDGE 0W20 - BULK			24.47	24.47	171.29
7	EHC5	Environmental Handling Charge			0.05	0.05	0.35
1	LR011038	PLUG - BLANKING			11.84	7.52	7.52
2	LR049457	O-RING			9.75	4.64	9.28
6	LR092696	BOLT			7.92	3.77	22.62
2	LR090641	BOLT			11.82	5.63	11.26
1	LR010917	SCREW			3.60	1.72	1.72
2	FC110136	BOLT			11.10	5.28	10.56
7	LR006698	SCREW			12.27	5.85	40.95
1	LR011279	FILTER - OIL -			68.78	58.55	58.55
1	EHC50	Environmental Handling Charge			0.50	0.50	0.50
1	LR030593	SEAL			18.81	11.95	11.95
700	R1234YF	REFRIGERANT GRAM - R1234-YF			0.75	0.75	525.00
1	T4A1783	HOSE-ENGINE VENT			74.62	52.19	52.19
1	AJ814053	PIPE-HEATER			283.35	207.58	207.58

ON BEHALF OF SERVICING DEALER, I HEREBY CERTIFY THAT THE INFORMATION CONTAINED HEREON IS ACCURATE UNLESS OTHERWISE SHOWN. SERVICES DESCRIBED WERE PERFORMED AT NO CHARGE TO OWNER. THERE WAS NO INDICATION FROM THE APPEARANCE OF THE VEHICLE OR OTHERWISE, THAT ANY PART REPAIRED OR REPLACED UNDER THIS CLAIM HAD BEEN CONNECTED IN ANY WAY WITH ANY ACCIDENT, NEGLIGENCE OR MISUSE. RECORDS SUPPORTING THIS CLAIM ARE AVAILABLE FOR (1) YEAR FROM THE DATE OF PAYMENT NOTIFICATION AT THE SERVICING DEALER FOR INSPECTION BY MANUFACTURER'S REPRESENTATIVE.

STATEMENT OF DISCLAIMER
The factory warranty constitutes all of the warranties with respect to the sale of this item/items. The Seller hereby expressly disclaims all warranties, either express or implied, including any implied warranty of merchantability or fitness for a particular purpose. Seller neither assumes nor authorizes any other person to assume for it any liability in connection with the sale of this item/items.

DESCRIPTION	TOTALS
LABOUR AMOUNT	
PARTS AMOUNT	
DISCOUNTS	
SUBLET AMOUNT	
MISC. CHARGES	
TOTAL CHARGES	
LESS INSURANCE	
G.S.T./P.S.T.	
PLEASE PAY THIS AMOUNT	

(SIGNED) DEALER, GENERAL MANAGER OR AUTHORIZED PERSON (DATE)

CUSTOMER SIGNATURE

GST#8649462 RT 0001

Copyright 2014 CDK Global LLC SERVICE INVOICE TYPE 2 - SDCS - IMAGING

CUSTOMER COPY

CUSTOMER #: 123290

240378



INVOICE

JAGUAR LAND ROVER
EDMONTON
 DUPLICATE 2 17007 111th Ave. NW, Edmonton, AB T5S 0J5
 PAGE 4 Tel: 780-484-1818 Fax: 780-733-7942
 www.jlredmonton.com

BUS:		CELL:		SERVICE ADVISOR: 115397 KATE LAPINA			
COLOUR	YEAR	MAKE/MODEL	VIN	LICENSE	ODOMETER IN/OUT	TAG	
SILVER	18	LAND ROVER RANGE ROV	SALYM2RV9JA725974		98120/100739	T4138	
DEL DATE	PROD. DATE	WARR. EXP.	PROMISED	PO NO.	RATE	PAYMENT	INV. DATE
01JAN18 IS			17:00 11JUN25		238.00	CASH	24JUN25
01JAN18 DE							
R.O. OPENED		READY		OPTIONS: SOLD-STK:PC864 DLR:502 ENG:3.0_Liter			
08:35 10FEB25		11:07 24JUN25		TRN:8_Speed_Automatic			

LINE	OPCODE	TECH	TYPE	HOURS	LIST	NET	TOTAL
1	LR011279	FILTER	- OIL -		68.78	58.55	58.55
1	EHC50	Environmental Handling Charge			0.50	0.50	0.50
7	0208900	CASTROL EDGE 0W20 - BULK			24.47	24.47	171.29
7	EHC5	Environmental Handling Charge			0.05	0.05	0.35
2	LR023288	FLUID - TRANSMIS			128.04	116.40	232.80
2	EHC10	Environmental Handling Charge			0.10	0.10	0.20
1	LR050750	OIL - LUBRICANT			91.80	83.45	83.45
PARTS: 2129.76 LABOR: 4080.70 OTHER: 2.40 TOTAL LINE F:							6212.86

PERFORM ENGINE REPLACEMENT AS PER WSM, REMOVE TRANSMISSION, REMOVE ALL ENGINE BAY COMPONENTS FOR REMOVAL OF ENGINE. REMOVE ENGINE FROM ENGINE BAY, TRANSFER REQUIRED COMPONENTS TO GLOBAL WARRANTY SUPPLIED ENGINE. INSTALL ENGINE IN VEHICLE, INSTALL ALL REMOVED COMPONENTS AND TRANSMISSION. DRAIN OIL AND RENEW OIL FILTER, FILL ENGINE WITH NEW OIL, VACUUM BLEED AND FILL COOLING SYSTEM, PERFORM FUEL SYSTEM PRIME ROUTINE, CLEAR DTCS, CLEAR POWERTRAIN ADAPTATIONS. START ENGINE AND RUN TO OPERATING TEMP, VERIFY ENGINE RUNS AS DESIGNED. PERFORM MULTIPLE DRIVE CYCLES. NOTED COOLANT SMELL FROM ENGINE BAY, INSPECT AND FOUND RADIATOR LEAKING.

G** REPLACE ELECTRIC COOLANT FAN-INTERNAL FAILURE

L00 REPLACE ELECTRIC COOLANT FAN-INTERNAL FAILURE

116666 CEXT 2.00

1 LR137844 MOTOR AND FAN -

378.00 378.00

1 FRT AIR FREIGHT

1519.39 1215.51 1215.51

182.33 182.33 182.33

PARTS: 1215.51 LABOR: 378.00 OTHER: 182.33 TOTAL LINE G: 1775.84

REPLACE ELECTRIC COOLING FAN, VERIFY FAN OPERATION AS DESIGNED.

H** REPLACE LEAKING RADIATOR

L00 General Diagnostics

116666 CEXT 2.00

1 LR092460 RADIATOR - MAIN

378.00 378.00

1 FRT AIR FREIGHT

1073.45 858.76 858.76

1 LRN2279 FLUID - COOLING

128.81 128.81 128.81

1 EHC50 Environmental Handling Charge

44.56 40.51 40.51

0.50 0.50 0.50

ON BEHALF OF SERVICING DEALER, I HEREBY CERTIFY THAT THE INFORMATION CONTAINED HEREON IS ACCURATE UNLESS OTHERWISE SHOWN. SERVICES DESCRIBED WERE PERFORMED AT NO CHARGE TO OWNER. THERE WAS NO INDICATION FROM THE APPEARANCE OF THE VEHICLE OR OTHERWISE, THAT ANY PART REPAIRED OR REPLACED UNDER THIS CLAIM HAD BEEN CONNECTED IN ANY WAY WITH ANY ACCIDENT, NEGLIGENCE OR MISUSE. RECORDS SUPPORTING THIS CLAIM ARE AVAILABLE FOR (1) YEAR FROM THE DATE OF PAYMENT NOTIFICATION AT THE SERVICING DEALER FOR INSPECTION BY MANUFACTURER'S REPRESENTATIVE.

STATEMENT OF DISCLAIMER
The factory warranty constitutes all of the warranties with respect to the sale of this item/items. The Seller hereby expressly disclaims all warranties, either express or implied, including any implied warranty of merchantability or fitness for a particular purpose. Seller neither assumes nor authorizes any other person to assume for it any liability in connection with the sale of this item/items.

DESCRIPTION	TOTALS
LABOUR AMOUNT	
PARTS AMOUNT	
DISCOUNTS	
SUBLET AMOUNT	
MISC. CHARGES	
TOTAL CHARGES	
LESS INSURANCE	
G.S.T./P.S.T.	
PLEASE PAY THIS AMOUNT	

(SIGNED) DEALER, GENERAL MANAGER OR AUTHORIZED PERSON (DATE)

CUSTOMER SIGNATURE

GST#064946462 RT 0001

CUSTOMER COPY

CUSTOMER #: 123290

240378



INVOICE

JAGUAR LAND ROVER

EDMONTON

 DUPLICATE 2 17007 111th Ave. NW, Edmonton, AB T5S 0J5
 PAGE 5 Tel: 780-484-1818 Fax: 780-733-7942

www.jfredmonton.com

BUS:		CELL:		SERVICE ADVISOR: 115397 KATE LAPINA			
COLOUR	YEAR	MAKE/MODEL	VIN	LICENSE	ODOMETER IN/ OUT	TAG	
SILVER	18	LAND ROVER RANGE ROV	SALYM2RV9JA725974		98120/100739	T4138	
DEL DATE	PROD. DATE	WARR. EXP.	PROMISED	PO NO.	RATE	PAYMENT	INV. DATE
01JAN18 IS			17:00 11JUN25		238.00	CASH	24JUN25
01JAN18 DD							
R.O. OPENED		READY		OPTIONS: SOLD-STK:PC864 DLR:502 ENG:3.0_Liter			
08:35 10FEB25		11:07 24JUN25		TRN:8_Speed_Automatic			

LINE	OPCODE	TECH	TYPE	HOURS	LIST	NET	TOTAL
PARTS:	899.27	LABOR:	378.00	OTHER:	129.31	TOTAL LINE H:	1406.58
PERFORM RADIATOR REPLACEMENT, REMOVE CLEAN AIR INLET DUCTING, REMOVE COOLING FAN ASSEMBLY, REMOVE GRILLE AND UPPER RADIATOR SUPPORTS. RELEASE COOLANT HOSES FROM RADIATOR AND REMOVE. INSTALL NEW RADIATOR, INSTALL ALL REMOVED COMPONENTS, VACUUM BLEED AND FILL COOLING SYSTEM. RUN ENGINE TO OPERATING TEMP, ROAD TEST AND VERIFY NO LEAKS PRESENT, CHECK AND SET COOLANT EXPANSION TANK TO MAX FILL LEVEL.							

ESTIMATE: 62,265.30 04APR25 13:38 SA: 115397

CONTACT:

INTERNAL PAY SHOP CHARGE FOR REPAIR ORDER

(N/C)

GLOBAL COVERS 6194.35 TAX INCL

\$150.00 DEDUCTIBLE

Customer Pay GST on Repairs

469.62

ON BEHALF OF SERVICING DEALER, I HEREBY CERTIFY THAT THE INFORMATION CONTAINED HEREON IS ACCURATE UNLESS OTHERWISE SHOWN. SERVICES DESCRIBED WERE PERFORMED AT NO CHARGE TO OWNER. THERE WAS NO INDICATION FROM THE APPEARANCE OF THE VEHICLE OR OTHERWISE, THAT ANY PART REPAIRED OR REPLACED UNDER THIS CLAIM HAD BEEN CONNECTED IN ANY WAY WITH ANY ACCIDENT, NEGLIGENCE OR MISUSE. RECORDS SUPPORTING THIS CLAIM ARE AVAILABLE FOR (1) YEAR FROM THE DATE OF PAYMENT NOTIFICATION AT THE SERVICING DEALER FOR INSPECTION BY MANUFACTURER'S REPRESENTATIVE.	STATEMENT OF DISCLAIMER The factory warranty constitutes all of the warranties with respect to the sale of this item/items. The Seller hereby expressly disclaims all warranties, either express or implied, including any implied warranty of merchantability or fitness for a particular purpose. Seller neither assumes nor authorizes any other person to assume for it any liability in connection with the sale of this item/items.	DESCRIPTION	TOTALS
		LABOUR AMOUNT	4836.70
		PARTS AMOUNT	4244.54
		DISCOUNTS	0.00
		SUBLET AMOUNT	0.00
		MISC. CHARGES	314.04
		TOTAL CHARGES	9395.28
		LESS INSURANCE	0.00
		G.S.T. / P.S.T.	469.62
(SIGNED) DEALER, GENERAL MANAGER OR AUTHORIZED PERSON (DATE)	CUSTOMER SIGNATURE	PLEASE PAY THIS AMOUNT	9864.90

GST#86494642 RT 0001

Copyright 2014 CDK Global, LLC SERVICE INVOICE TYPE 2 - SIZE - IMAGING

CUSTOMER COPY

There is
 owing. 2015